

# Work Order ID 77533

**\*77533\***

Page 1

December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Item Name: Crosstube Aft

Stop **\*NS2\***

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: M.C.J.

Date: 11/12/13

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D412-664-243	E/DEO

100  
**\*100\***  
DC  
Document Control

DOCUMENT CONTROL

Memo  
Photocopy bluefile and create labels as per PPP D412-664-203 CHG 008

0.00

110  
**\*110\***  
Packaging  
Packaging

Packaging

Memo

0.00

120  
**\*120\***  
CNC Bend 2  
CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo  
Bend tube as per Dwg D412-664-243 using CNC bender program 412-aft and Folio FT010

0.00

MO 11-12-20



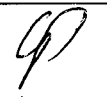

MO 11-12-20

12 01 06 (1)

W/O: 77533		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D412-664-203 PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

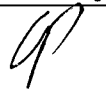NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11.12.21	120	Tube crushing is over tolerance	 11.12.21 CS/042	Acceptable based on attached analysis	N/A	 11.12.21 CS/042	 11.12.21 CS/042	 11.12.21

NOTE: Date & initial all entries

**Work Order ID 77533****\*77533\***

Page 2

December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Item Name: Crosstube Aft

Stop **\*NS2\***

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 <b>*130*</b> QC Quality Control	QC15- Crosstube Dimensional Check  Memo	0.00 0.00		8 u 1 (2/2)					
140 <b>*140*</b> Crosstubes Crosstubes	Crosstubes  Memo 1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers.  2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.  3-SCRIBE PART # & BATCH #  4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243	0.00 0.00							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**\*775.3.3\***

December-13-11 8:36:58 AM

**\*N900040100\***

Setup Start \*NS1\*

Stop **\*NS2\***

**\*1\***

**\* 1 \***

**Reference:**

Run Start \*NR1\*

Stop \*NR2\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

0.00

0.00

Tw

11-12-2

0.00

0.00

S u/2/r/

0.00

0.00

8 u/12/21

## Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 77533

**\*77533\***

Page 4

\*December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Item Name: Crosstube Aft

Stop **\*NS2\***

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	Outsource process - NDT per QSI038 4.1	0.00							
<b>*180*</b>									
Outsource2	Memo	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038 Or Issue P/O: <u>15746</u> as per ASTM 1417 Level 2 Attach copy of NDT results to work order								
190	Packaging	0.00							
<b>*190*</b>									
Packaging	Memo	0.00							
Packaging	Inspect for transit damage Ensure copy of NDT results attached to work order.								
200	QC5- Inspect part completeness to step on W/O	0.00							
<b>*200*</b>									
QC	Memo	0.00							
Quality Control	Inspect for damage & ensure results are as per Dwg D412-664-203								

*11-12-23*

*P107*

*11/12/23 (1)*

*11-12-23 (1)*

W/O: 77533		<del>77533</del> WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D412-664-203 PAR #: \_\_\_\_\_ Fault Category: Landig Gear NCR: Yes No DQA: Start Date: 12/1/11  
cross tubes  
 Resolution: Rework Disposition: Rework QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR: 11-1104		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11/12/23	#190	indentifying Faults During WDT testing R.L. Process	CP 11.12.23 BS/042	→ Build out electric ACCT → Re to ALUMIN AS PER Q52001 → Re NDT inspect	JW 11-12-23	S 11/12/23	CP 11.12.23 BS/042	S 11/12/23

NOTE: Date &amp; initial all entries



**Work Order ID 77533****\*77533\***

Page 5

December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

0.00

**\*210\***

SprayPaint

SprayPaint

Memo

0.00

Spray Painting

\*\*\*Mask underside of crosstube as shown\*\*\*

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per DEO D412-664-243 and QSI 005 4.2

PRIME:

Start Time: 3:30Finish Time: 5:30

PAINT:

Start Time: 7:45Finish Time: 9:45

*[Signature]* / AJ 11-12-29  
*[Signature]* / AB 11-12-30

220

QC14- Inspect Spray Paint

0.00

**\*220\***

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

① B 12.01.03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Work Order ID 77533

**\*77533\***

Page 6

December-13-11 8:36:58 AM

Item ID: D412-664-203 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Crosstube Aft  
 Start Date: 13/12/2011 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 02/01/2012 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	Crosstubes	0.00							
<b>*230*</b>									
Crosstubes	Memo	0.00							
Crosstubes	Assemble as per Dwg D412-664-203								
	1- Install chafing shield as per DEO D412-664-243. Top holes should be facing up. A/R Proseal 890 Batch: <u>119396</u> EXP: <u>05/12</u>								
	2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe								
	3-Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D12-664-243 using installation jig DT9024. Torque clamps as per dwg A/R Scotch-Weld DP460 Batch: <u>119341</u> EXP: <u>21 OCT 2012</u>								
240	QC5- Inspect part completeness to step on W/O	0.00							
<b>*240*</b>									
QC	Memo	0.00							
Quality Control									

*Handwritten:* 1A2 12-01-03

*Handwritten:* Sizbols

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 77533****\*77533\***

Page 7

December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Pick Kit	0.00							
<b>*250*</b>									
Packaging	Memo	0.00							<u>12/01/11</u> (1)
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00							
<b>*260*</b>									
QC	Memo	0.00							<u>12.01.06</u> (1)
Quality Control									
270		0.00							
<b>*270*</b>	Packaging								
Packaging	Memo	0.00							<u>12/01/11</u> (1)
Packaging	Identify and pack for shipping as per PPP D412-664-203								
	*****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27								
	for application time & date *****								
	Time & date of packaging: _____								
	Location: _____								

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 77533****\*77533\***

Page 8

December-13-11 8:36:58 AM

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 13/12/2011 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 02/01/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Run Start **\*NR1\***Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

280

QC21- Final Inspection - Work Order Release

0.00

**\*280\***

QC

Memo

0.00

Quality Control

MF  
12-01-06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

December-13-11 8:37:02 AM

Page 1

Work Order ID: 77533

**\*77533\***

Parent Item: D412-664-203

**\*D412-664-203\***

Parent Item Name: Crosstube Aft

Start Date: 13/12/2011

Required Date: 02/01/2012

Start Qty: 1.00

Required Qty: 1.00

## Comments:

IPP Rev:E04.02.16Reformat; Added D3189-1K/DS  
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM  
 IPP Rev:G 06.12.08 per ECN 886 EC  
 IPP Rev:H 07-04-30 As per Rev D JLM  
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J  
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K  
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D412-664-203TRN

Manufactured No

110

Each

3.0000

1

1

**\*D412-664-203TRN\***

**\*\***

Crosstube Turning Detail

### Location

### Loc Qty

### Loc Code

LG

3

77198

1

77199

1

77306

1

D2896-1

Manufactured No

230

Each

31.0000

1

1

**\*D2896-1\***

**\*\***

Support

### Location

### Loc Qty

### Loc Code

LG053

31

71502

10

74465

21

D3189-1

Manufactured No

230

Each

38.0000

2

2

**\*D3189-1\***

**\*\***

Chafing Shield

### Location

### Loc Qty

### Loc Code

FG

4

36065

4

LG053

34

71353

22

73534

12

MO 11-12-20

12-01-03

12-01-03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Page 2

December-13-11 8:37:02 AM

Work Order ID: 77533

**\*77533\***

Parent Item: D412-664-203

**\*D412-664-203\***

Parent Item Name: Crosstube Aft

Start Date: 13/12/2011

Required Date: 02/01/2012

Start Qty: 1.00

Required Qty: 1.00

D3595-063-570

Manufactured No

230

Each

134.0000

2

2

**\*D3595-063-570\***

**\*\***

RUBBER CUSHION

Location

Loc Qty

Loc Code

FG

8

37971

1

42243

7

MAT052

126

71534

49

76546

77

2

12-01-03

MS21920-28

Purchased

No

230

Each

66.0000

4

4

**\*MS21920-28\***

**\*\***

Clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

61

116839

2

118713

4

119285

5

119920

50

4

12-01-03

MS21920-30

Purchased

No

230

Each

98.0000

2

2

**\*MS21920-30\***

**\*\***

clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

LG

50

119529

50

LG050

34

117998

34

LG051

14

111258

14

2

12-01-03

December-13-11 8:37:02 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

December-13-11 8:37:02 AM

Work Order ID: 77533

\*77533\*

Parent Item: D412-664-203

\*D412-664-203\*

Parent Item Name: Crosstube Aft

Start Date: 13/12/2011

Required Date: 02/01/2012

Start Qty: 1.00

Required Qty: 1.00

AN6-40A	Purchased	No	250	Each	56.0000	4	4	
<b>*AN6-40A*</b>						**		
Bolt								

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
ST342	56	
119449	6	
119749	50	

119790

AN6-41A	Purchased	No	250	Each	35.0000	2	2	
<b>*AN6-41A*</b>						**		
Bolt								

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
ST342	35	
119449	15	
119749	20	

119449

AN960JD616	NAS1149D0663J	Purchased	No	250	Each	0.0000	18	18
<b>*AN960JD616*</b>						**		
Washer								

119075

MS21042L6		Purchased	No	250	Each	1,310.000	6	6
<b>*MS21042L6*</b>						**		
Nut								

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
ST300	1310	
117677	25	
118384	5	
118927	48	
118968	182	
119075	1000	
119736	50	

118968

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

DART AEROSPACE LTD		Work Order:	77533
Description: Crosstube High Aft (412)		Part Number:	D412-664-203
Inspection Dwg: D412-664-243 Rev: E		Page 1 of 1	

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70

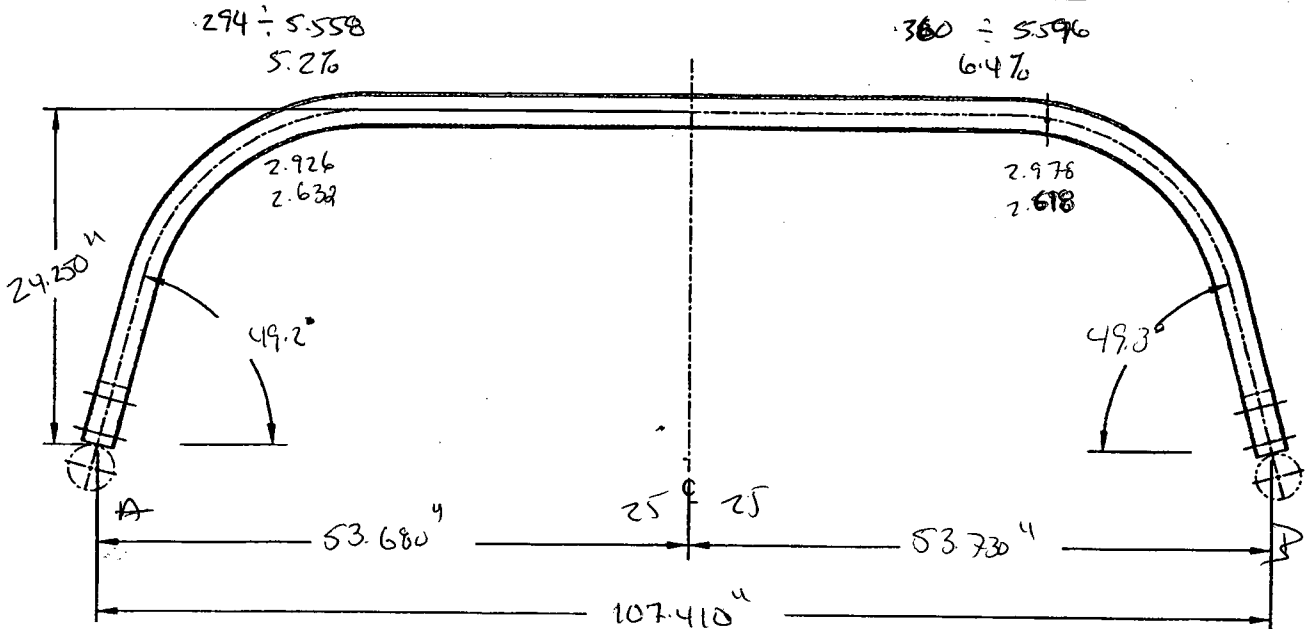

Comments
Side A = 5.276 crushin @ 25 passes
Side B = 6.476 crushin @ 25 passes

QC15 Inspection	<i>J</i>
Date	4/12/21

POSITIVE RECALL  
EFFECTIVE 4/12/20 AUTH *CP*  
RELEASED *CP* DATE 4/12/21

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	<i>[Signature]</i>

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129  
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 77533 M.L.J  
1112113

② DEO ATTACHED

RELEASED  
2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D412-664-243	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries


77533

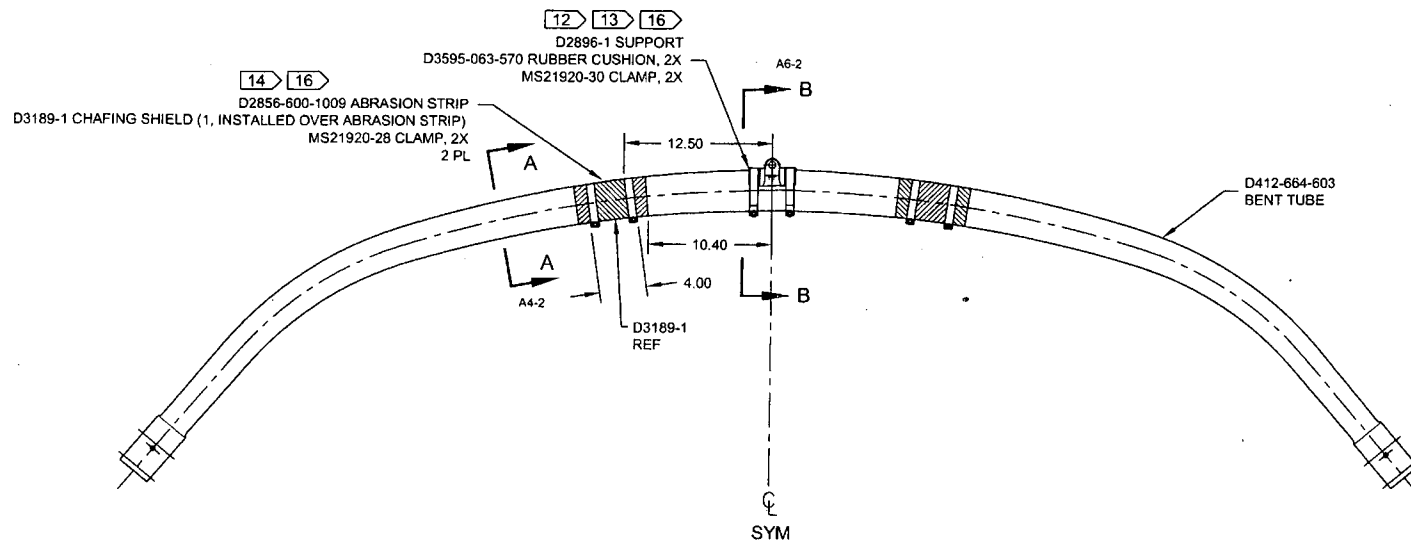

**D212-664-243**  
**ASSEMBLY DETAIL**

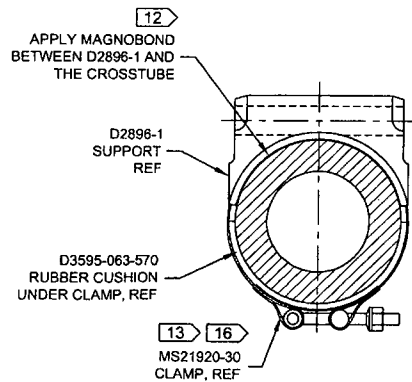

**SECTION B-B** D4-2  
SCALE 4X

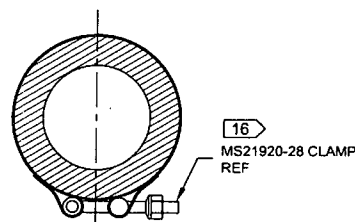

**SECTION A-A** C6-2  
SCALE 4X

2 DEO ATTACHED

**RELEASED**  
2009-10-29

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. E
MFG. APPR.	13	D412-664-243	SHEET 2 OF 4
APPROVED	14	TITLE	SCALE
DE APPR.	14	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77533

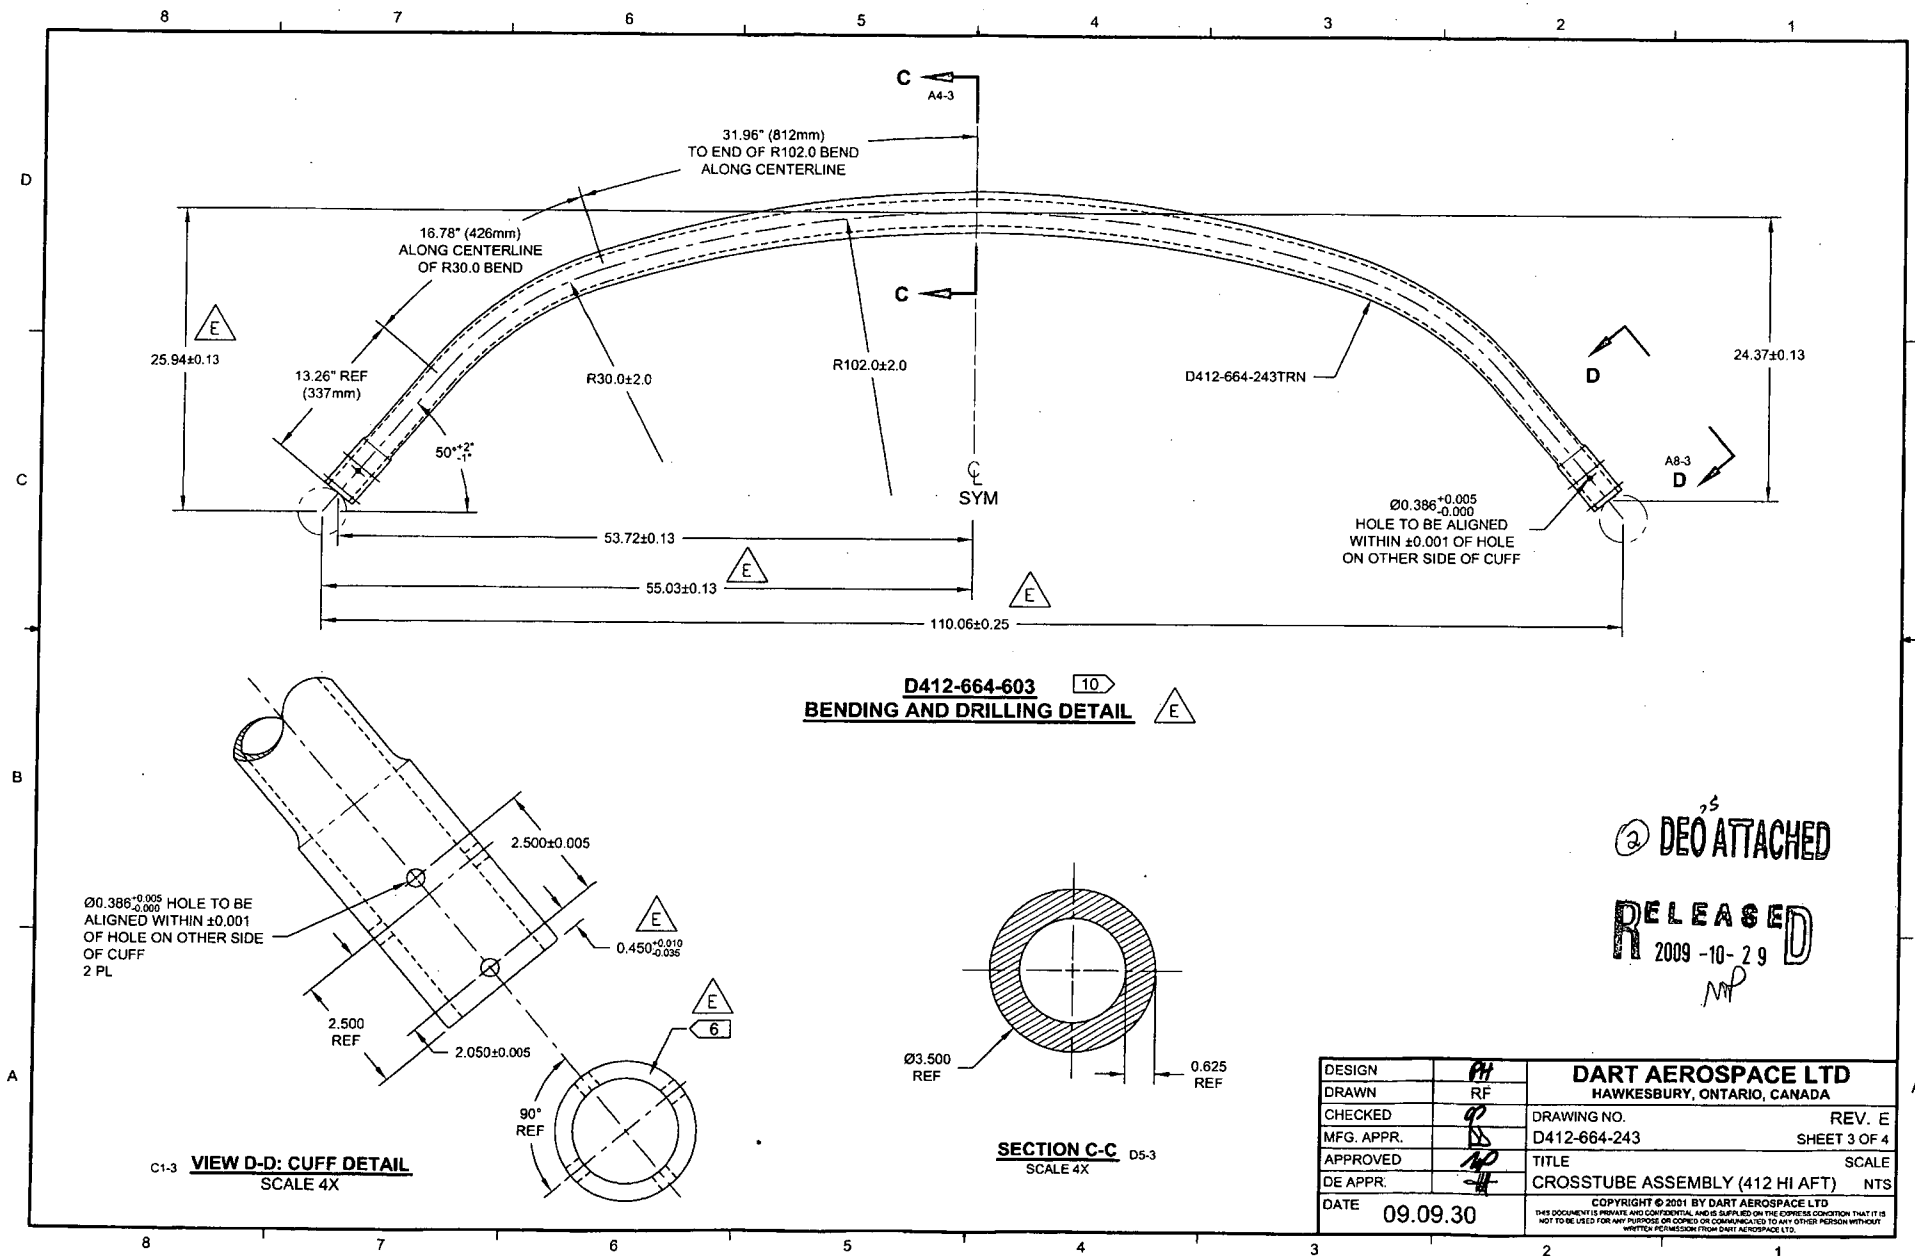

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77533

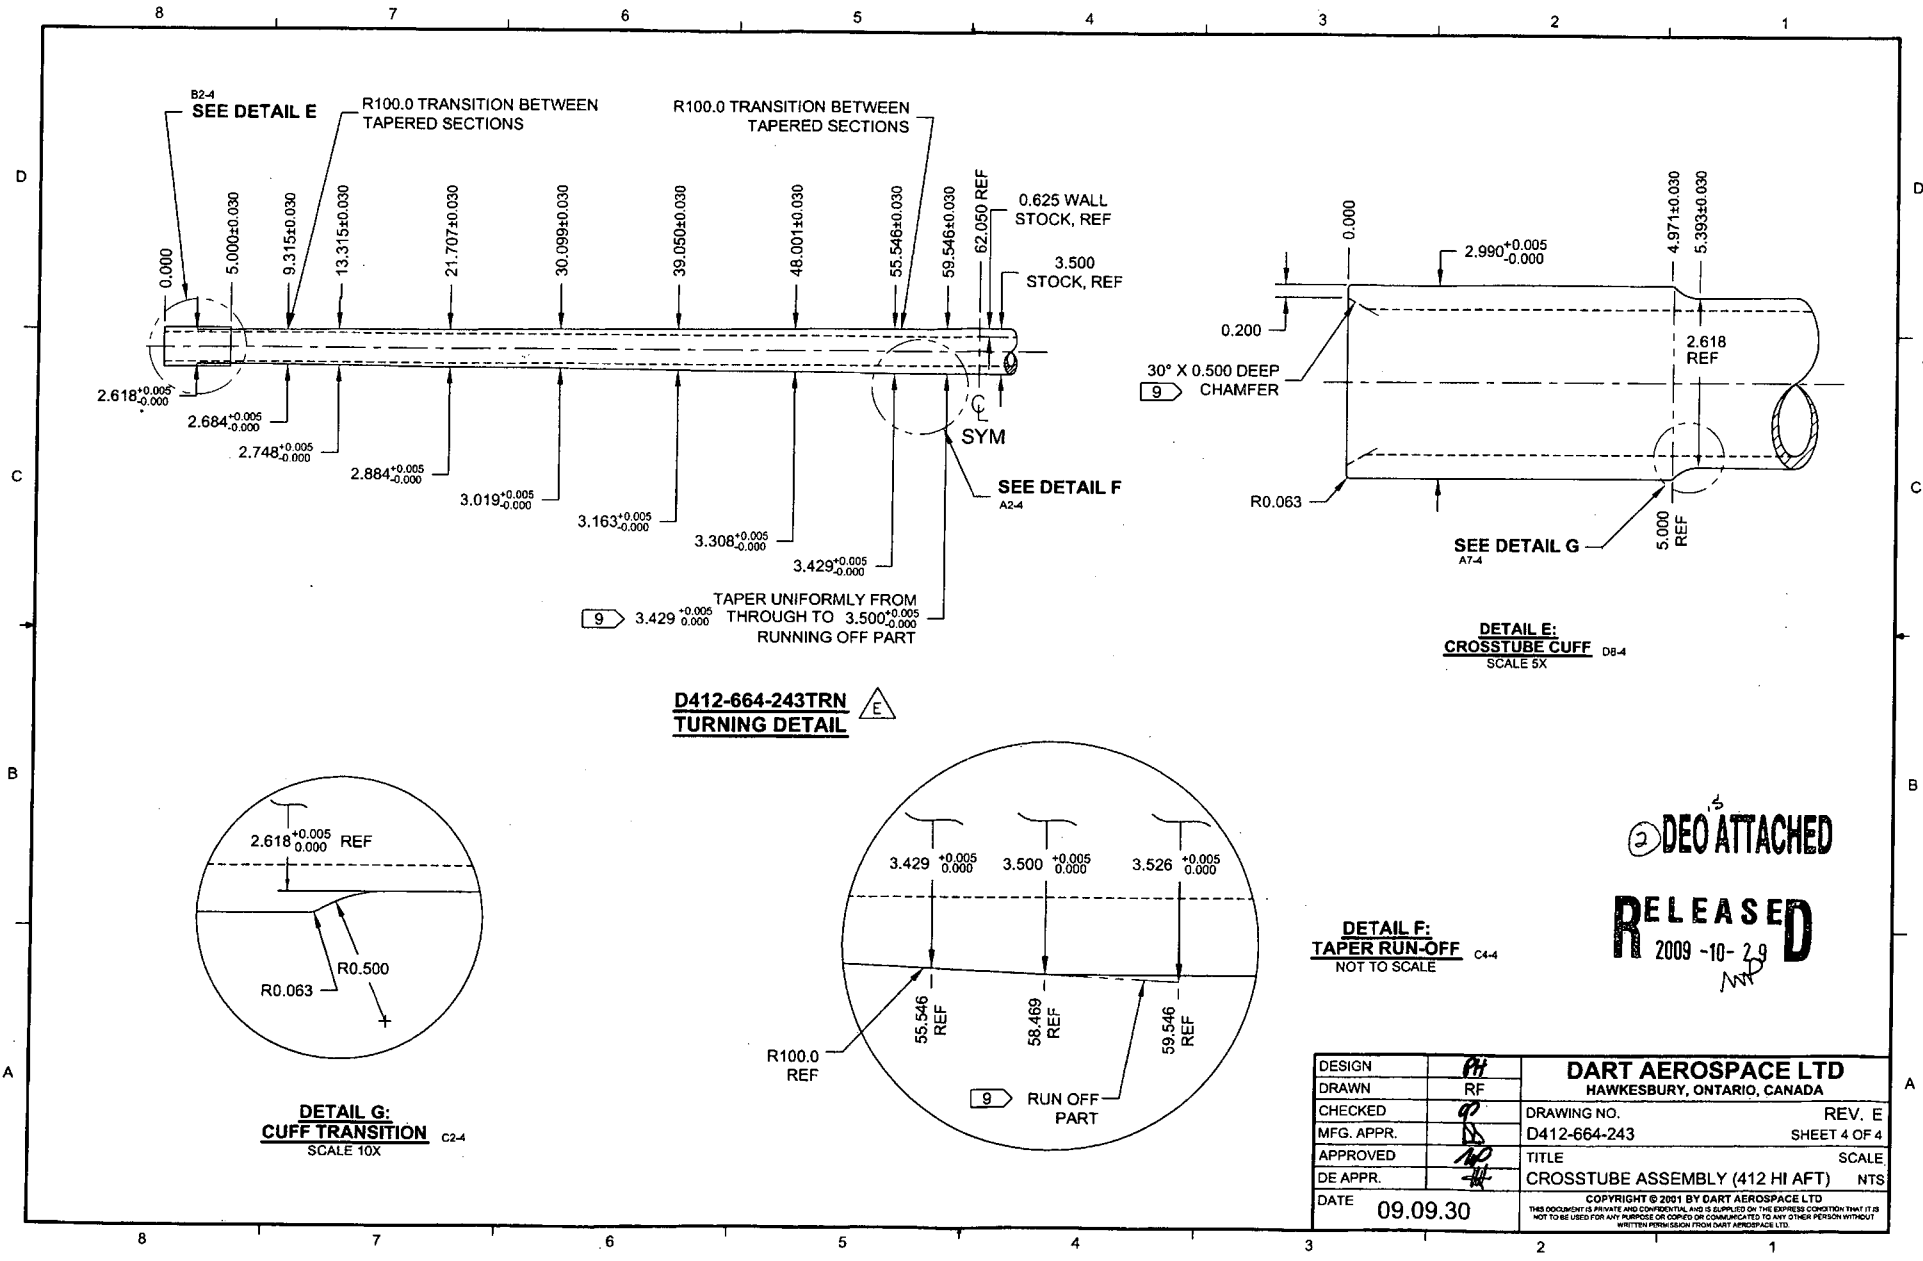

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	AS	D412-664-243	SHEET 4 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	AL	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval. QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



77533

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED <i>MP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.03.31	DATE 11/03.31	DATE 11.03.31	DATE 11/03.31		DATE 11.03.31		

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

**WAS:**

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1  
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL  
PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF  
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF  
CROSSTUBE PER QSI 035.

RELEASED  
2011-04-07  
*MP*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval. QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77533


DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DE APPR. <i>[Signature]</i>		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

**IS:**


D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)  
MS21920-28 CLAMP, 2X  
2 PL

**WAS:**

D2856-600-1009 ABRASION STRIP  
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)  
MS21920-28 CLAMP, 2X  
2 PL

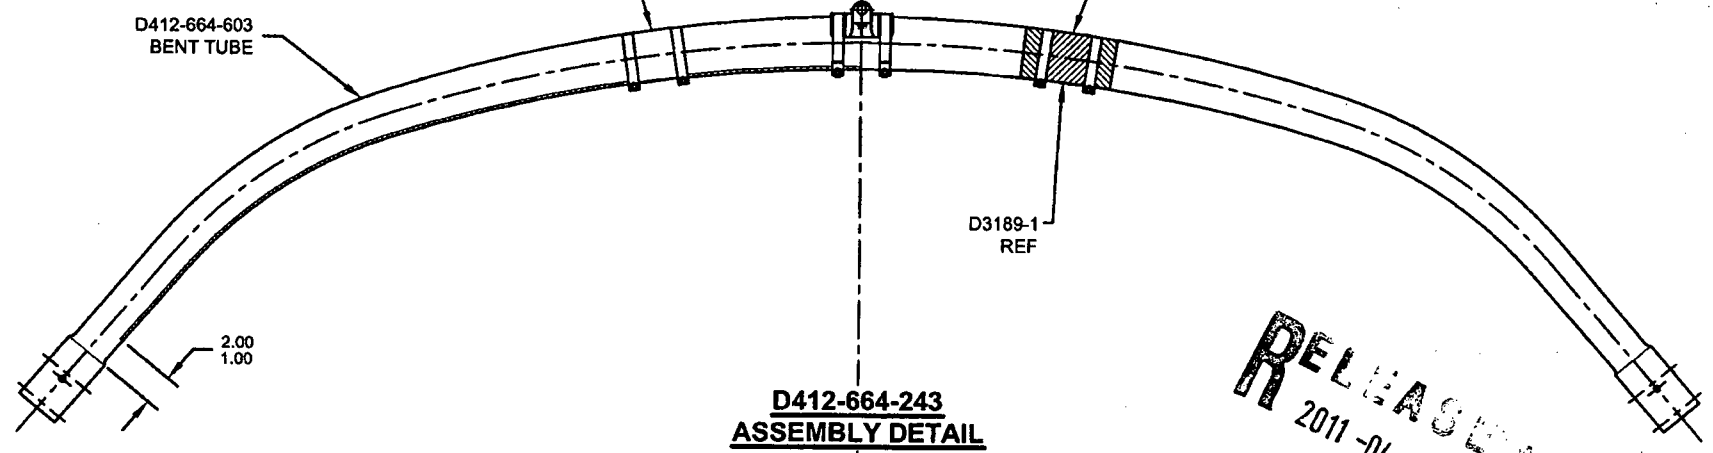

**RELEASED**  
2011-04-07  
*[Signature]*

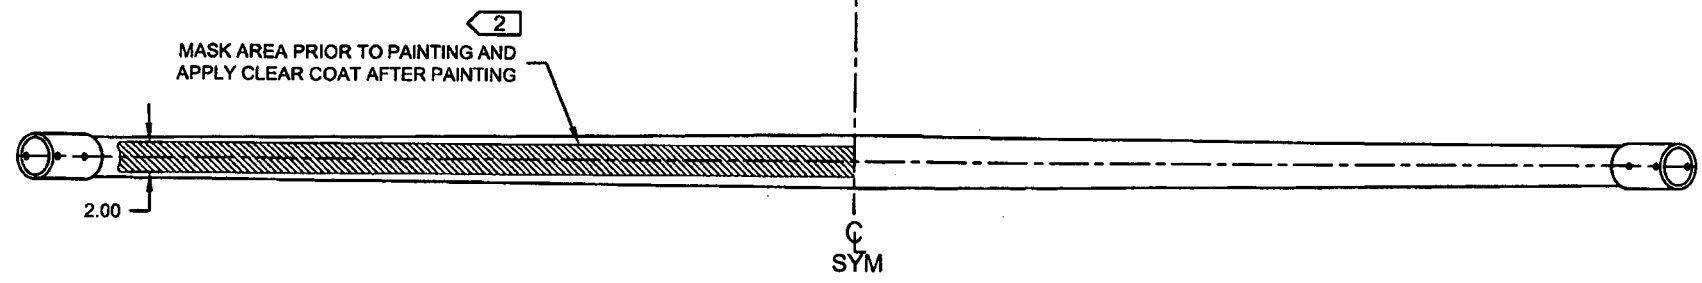

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval. QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

77533

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN JP	CHECKED ASS	MFG. APPR. E	APPROVED MP		DE APPR. H		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

**PURPOSE:**

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

**CHANGE:**

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:

- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-09-29  
MP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

11.12.06

CRUSHING OF D412-664-243

Acceptability of 8% CRUSHING AT END OF BEND

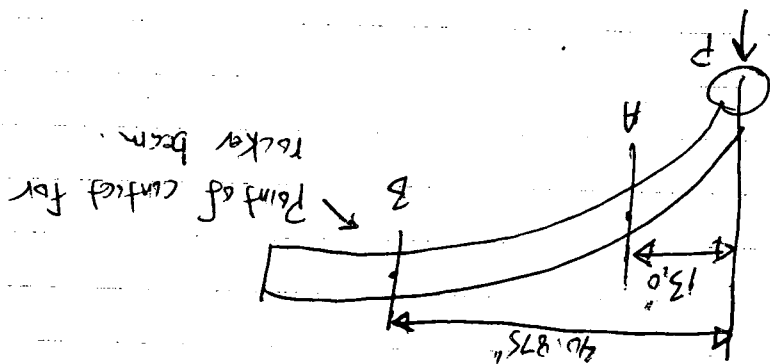

Point A:  $CD_1 = 2.961$ ,  $CD_2 = 2.522$

CRUSHING =  $(2.961 - 2.522) / (2.961 + 2.522) = 8\%$   
 $I = 1.676 \text{ in}^4$  (from AutoCAD)  
 Point B:  $CD_1 = 3.307$ ,  $I = 4.613 \text{ in}^4$

A:  $F = M_c / I = P \times 13 \times 2.961 / 2 \times 1.676 = 11484.8 \cdot P$   
 B:  $= P \times 40.875 \times 3.307 / 2 \times 4.613 = 14.651 \cdot P$

M.S. =  $14.651 / 11.484 - 1 = 0.27$

∴ Tube will break at rocker beam contact before area of 8% crushing, 8% crushing in area at end of tube  
 bend is acceptable

11.12.06



## LIQUID PENETRANT TEST REPORT

P- 12247

PAGE 1 OF 1

CLIENT DART Aerospace DATE DEC 23-2011 TIME AM ☒ PM ☐  
ATTENTION CHARLIE ACUREN JOB NO. 188-11-0870  
ADDRESS 1270 ABERDEEN PO/VO NO. 15745  
HAVERBURY ON. WORK LOCATION SAME  
ACCEPTANCE STD. ASTM 1417/AS1-08 REV./DATE 2008  
PROJECT FP II ON CROSS TUBES + MACHINED PARTS  
ITEM(S) EXAMINED 2 CROSS TUBES  
2 ENGINE MOUNTS

JOB DESCRIPTION PROCEDURE NO. LT002 REV./DATE 2008 TECHNIQUE NO. LT002 REV./DATE 2008  
PART NO. SEE RESULTS MATERIAL ALUMINUM THICKNESS VARIABLES  
SCOPE A WET FLOUORESCENT LIQUID PENETRANT INSPECTION  
WAS CARRIED OUT ON THE EXTERNAL SURFACE

## TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED  
FAMILY BRAND WAGNAFLUX BLACK LIGHT S/N 16459 ☐ OUTPUT > 1000  $\mu$ W/cm<sup>2</sup> ☐ AMBIENT < 2 fc  
PENETRANT 2LG7 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE  
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER WAGNA  
DEVELOPER SKDS2 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N 1098866 CAL DUE DATE FEB  
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY 02/2012

## TEST SURFACE

SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☐ CLEAN BARE METAL  
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

1 CROSS TUBE W.O. 77533 ✓  
1 CROSS TUBE W.O. 77534 ✓  
2 ENGINE MOUNTS ✓  
W.O. 77099

NOTE HAD TO BE REGRIND  
NOTE HAD TO BE REGRIND

11.12.13

## Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

## Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE Matthew Murdoch PRINT Matthew Murdoch SIGNATURE DTR # E-96971  
TECHNICIAN (SIGNATURE): Mike J. Austin 1<sup>ST</sup> TECHNICIAN Mike J. Austin 2<sup>ND</sup> TECHNICIAN  
NAME (PRINT): Mike J. Austin CGSB LEVEL II SNT LEVEL II CGSB LEVEL II SNT LEVEL II  
CGSB REG. NO. 6606 CGSB REG. NO. 6606

REPORT REVIEWED BY: NAME INITIALS



# Location/Lot Activity

Thursday, March 29, 2012 12:36:44 PM

Page 1 of 3

Criteria : All Items All Locations Lot: 71502 All Transaction Types All Dates Report on Locations & Lots

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Account Value Change	D2896-1 / Support	Main Warehouse		FAUT01		20.0000		20.0000		
		LG			10/19/2011	-20.0000	71502	-20.0000		(\$6,397.93)
		Main Warehouse		FAUT01		20.0000		20.0000		
		LG			10/19/2011	20.0000	71502	20.0000		\$6,397.93
								0.0000		\$0.00
Inv Adjustment	D2896-1 / Support	Main Warehouse	Found	FAUT01		21.0000		0.0000		
		LG053			3/7/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	Found	FAUT01		21.0000		0.0000		
		LG053			3/7/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	B/N correction	GOLD01		21.0000		0.0000		
		LG053			3/23/2012	1.0000	71502	1.0000		\$319.90
		Main Warehouse	B/N correction	GOLD01		21.0000		0.0000		
		LG053			3/27/2012	1.0000	71502	1.0000		\$319.90
								4.0000		\$1,279.59
Issue	D2896-1 / Support	Main Warehouse	73691	QUIR01		20.0000		20.0000		
		LG			10/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	73690	QUIR01		19.0000		19.0000		
		LG			10/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	75417	QUIR01		18.0000		18.0000		
		LG			11/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	75416	QUIR01		17.0000		17.0000		
		LG			11/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	74376	FAUT01		16.0000		16.0000		
		LG			11/21/2011	-1.0000	71502	-1.0000		(\$319.90)

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Issue	D2896-1 / Support	Main Warehouse	74377 -203	FAUT01		15.0000		15.0000		
		LG			11/21/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	76351 -203	DESJ02		35.0000		14.0000		
		LG053			12/6/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	76350 -203	DESJ02		34.0000		13.0000		
		LG053			12/6/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77108 -203	DESJ02		33.0000		12.0000		
		LG053			12/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77273 -203	LAVO01		32.0000		11.0000		
		LG053			12/9/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77109 -203	DESJ02		31.0000		10.0000		
		LG053			12/13/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77433	QUIR01		30.0000		9.0000		
		LG053			12/19/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77434	QUIR01		29.0000		8.0000		
		LG053			12/20/2011	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77748	FAUT01		28.0000		7.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77533	FAUT01		27.0000		6.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	77534	FAUT01		26.0000		5.0000		
		LG053			1/6/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	78576	FAUT01		25.0000		4.0000		
		LG053			2/22/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse	78574	FAUT01		24.0000		3.0000		
		LG053			2/22/2012	-1.0000	71502	-1.0000		(\$319.90)

Iss  
 71502  
 11/10/13  
 11/10/19  
 74465

Transaction Type	Item ID/ Item Name	Warehouse Location ID	Reason	Employee ID Location Code	Loc Trans Date	LocQtyPrior/ Location Qty	Lot Number	LotQtyPrior/ Lot Qty	Shelf Life Date Lot Code	Extended Cost
Issue	D2896-1 / Support	Main Warehouse LG053	78575	FAUT01		23.0000		2.0000		
					2/22/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	78573	GOLD01		22.0000		1.0000		
					2/24/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80135	FAUT01		22.0000		1.0000		
					3/7/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80134	FAUT01		22.0000		1.0000		
					3/7/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80585	GOLD01		22.0000		1.0000		
					3/23/2012	-1.0000	71502	-1.0000		(\$319.90)
		Main Warehouse LG053	80584	GOLD01		22.0000		1.0000		
					3/27/2012	-1.0000	71502	-1.0000		(\$319.90)
									-24.0000	(\$7,677.51)
Loc Transfer	D2896-1 / Support	Main Warehouse LG053		GOLD01		0.0000		0.0000		
					11/30/2011	14.0000	71502	14.0000		\$4,478.55
		Main Warehouse LG		GOLD01		14.0000		14.0000		
					11/30/2011	-14.0000	71502	-14.0000		(\$4,478.55)
									0.0000	\$0.00
WIP Receipt	D2896-1 / Support	Main Warehouse LG	71502	GOLD01		0.0000		0.0000		
					10/3/2011	20.0000	71502	20.0000		\$6,397.93
									20.0000	\$6,397.93